

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 1

Item ID: D212-664-201 Accept *N900040100* Setup Start *NS1*
 Revision ID: Stop *NS2*
 Item Name: Aft Crosstube - High
 Start Date: 3/8/2017 Start Qty: 1.00 *1* Cust Item ID:
 Required Date: 3/16/2017 Req'd Qty: 1.00 *1* Customer:
 Reference: SCHEDULED

Approvals: Process Plan: DAS 21 9-89 Date: MAR 06 2017 Tooling: _____ Date: _____ Run Start *NR1*
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop *NR2*

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
Draw Nbr	Revision Nbr								
D212-664-241	E								
DSI9563	B								
100	Document Control	0.00							
100	DOCUMENT CONTROL								
DC	Memo	0.00							
Doc.Control -USB or Paperwork	Photocopy bluefile and create labels as per PPP D212-664-201		CHG006						
110	Pick Kit	0.00							
110	Packaging								
Packaging	Memo	0.00							
Packaging									

D212-664-201/157964

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 2

Item ID: D212-664-201

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

120

0.20

120

CNC Bend 2

CNC Alpha 160 Bender

BENDING MACHINE - CROSSTUBES

Memo

0.18

VERF SET-UP BEFORE BENDING BY: tu

Bend tube as per Dwg D212-664-241 using CNC bender program 212-aft

OP 17-03-14

130

0.00

130

QC

Quality Control

QC15- Crosstube Dimensional Check

Memo

0.00

DAS
47
9-89

1 / 0

17-03-15

DQA:

Date:

2017-04-05



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed:

Date:

APR 01 2017

Work Order update only

Work Order: <u>157964</u>	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☒ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS					
Part No. <u>D212-664-201</u>		Skid-tube ☐	Cross tube ☒	Water Jet ☐	Engineering ☐		
NCR No. <u>17-6364</u>		Machining ☐	Small Fab ☐	Prod. Eng. Coord. ☐	Quality ☐		
		Thermoforming ☐	Finishing ☐	Rec/Store/Packaging ☐	Other ☐		
	Large Fab ☐	Composite ☐	Supplier ☐				

Date: <u>12/3/15</u>	Step #: <u>120</u>	QTY Effective: <u>①</u>	MRB (QSI042) Approval DAS 12 9-89 <u>17/3/15</u>
----------------------	--------------------	-------------------------	---

Description Work Order Deviation	Disposition	Completed By DAS 12 9-89 <u>17/3/15</u>
One side bent narrower.	Acceptable. Width/height is within what has been accepted in the past without fit issues.	Lead hand / Supervisor Approval Verification DAS 9 9-89 <u>17-03-15</u>
		QC / QA Coordinator Approval DAS 9 9-89 <u>17-03-15</u>

Root Cause				FAULT CATEGORY			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐		
Design ☐	Operator ☐	☒ Bending	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐		
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐		
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐		
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐		
Material ☒	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐		
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐		
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐		
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐		
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐		
Past Expiry Date ☐	Manufacturing Process ☐	OTHER :					
Misidentified ☐	Past Due ☐						

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 3

Item ID: D212-664-201

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

140

0.02

140

Crosstubes

Crosstubes

Memo

0.23

1-Drill pilot holes in tube as per Dwg D212-664-241 using drill Jig DT8550, DT8551, drill table DT8577 and locate tower holes #8 as per QSI0010.

2-Ream hole to finish size in tube as per Dwg D212-664-241 using drill Jig DT8550 & DT8551. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Scribe part # and batch # using vibrating stylus as per Dwg D212-664-241

4- ***WEAR LATEX GLOVES HANDLINE CROSSTUBE.*** Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D212-664-241

150

0.00

150

HandFXtube

Memo

0.11

IMMEDIATELY AFTER GRINDING

1- PRESSURE WASH X-TUBE INSIDE AND OUT

2- ALODINE AND ACID ETCH X-TUBE INSIDE AND OUT AS PER QSI005.

Hand Finishing Crosstubes

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐		OTHER : _____					

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 4

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Aft Crosstube - High

Stop ***NS2***

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

160

QC7-Inspect Chemical Conversion Coat

0.00

160

QC

Memo

0.00

Quality Control

MAR 16 2017

170

QC5- Inspect part completeness to step on W/O

0.00

170

QC

Memo

0.00

Quality Control

MAR 16 2017

180

Outsource process - NDT per QSI038 4.1

0.00

180

Outsource2

Memo

20.00

Outsource process - NDT

MAR 17 2017

DAS
13
6-88

Liquid Penetrant Inspection as per QSI 038

Issue P/O: 35625

LPI as per ASTM 1417 Level 2

Attach copy of NDT results to work order

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation			Disposition		
			Completed By		
			Lead hand / Supervisor Approval Verification		
			QC / QA Coordinator Approval		
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐
OTHER : _____					

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 5

Item ID: D212-664-201

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

190

Receive & Inspect for Damage & Mat'l Certs
Packaging

0.00

190

Packaging

Memo

0.00

WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.

Ensure copy of NDT results attached to work order.

1X SP 17-03-17.

200

QC5- Inspect part completeness to step on W/O

0.00

200

QC

Quality Control

Memo

0.00

WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE.

Inspect for damage & ensure results are as per Dwg D212-664-241

1 17-03-21

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coor. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐							
		OTHER : _____							

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 6

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 3/8/2017 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00 ***1***

Customer:

Reference: SCHEDULED

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210

Spray Painting per QSI005 4.2

0.00

210

SprayPaint

0.35

SprayPaint

Memo

*** WEAR LATEX GLOVES WHEN HANDLING CROSSTUBE***

VERIFY BY DAS BATCH # TO MATCH W/O157964 41VERIFY BY 9-89 PART # TO MATCHW/O 157964

MASK SCRIBE B# & P# AND VERIFY

1-Prime inside & outside crosstube as per QSI 005 4.2

BATCH: 136615

2- After painting remove masking and apply matte clear coat per QSI005 4.2

BATCH: 1362053- MASK UNDERSIDE OF CROSSTUBE AS SHOWN ON DWG BEFORE
PAINTING

4 -Paint Outside of Tube as per Dart QSI 005 4.2

BATCH: 136798DAS
41
9-89

MAR 17 2017

MAR 18 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
OTHER : _____									

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 7

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Item Name: Aft Crosstube - High

Stop ***NS2***

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

220

QC14- Inspect Spray Paint

0.00

220

QC

Memo

0.00

Quality Control

Then, Wrap in plastic bag to protect from scratches

VERIFY BY RB BATCH # TO MATCH W/OVERIFY BY RB PART # TO MATCHW/O 157964

17-03-21

DQA: _____ Date: _____

**WORK ORDER NON-CONFORMANCE / UPDATE**

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coor. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval 		
Description Work Order Deviation				Disposition					
				Completed By					
				Lead hand / Supervisor Approval Verification					
				QC / QA Coordinator Approval					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____									

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 8

Item ID: D212-664-201

Accept

N900040100

Setup Start

NS1

Revision ID:

Stop

NS2

Item Name: Aft Crosstube - High

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start

NR1

QC:

Date:

SPC (Y/N):

Date:

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

230

0.00

230

Crosstubes

Crosstubes

Crosstubes

Memo

0.36

*****LAY DOWN CORSTUBE ON TABLE AND PUT DT10302 PINS IN
SADDLE HOLE FACING UP, USE HOLE IN TAPE MESURE TO PUT IN
PINS FOR LOCATING CENTER OF CROSSTUBE. *****

1- Abrade mating surfaces of support and crosstube with 180 grit sandpaper,
clean the area with MEK or equivalent as per dwg

2- Install supports with Proseal 890 per D212-664-241 and QSI 015

A/R Proseal 890

Batch: 136953EXP: 10/17

PROSEAL CURE TIME 72 HOURS:

Start: 17-03-20Finish: 17-03-23

3- Install clamps with rubber cushion (ENSURE CLAMPS ARE INSTALL ON
TOP SIDE OF CROSSTUBE) using DT9565 as per Dwg D212-664-241.

Torque all clamps to 80-100 IN-LBS.

MAR 20 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 9

Item ID: D212-664-201

Accept

N900040100

Setup

Start

NS1

Revision ID:

Item Name: Aft Crosstube - High

Stop

NS2

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run

Start

NR1

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop

NR2Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

240

QC5- Inspect part completeness to step on W/O

0.00

240

QC

Quality Control

Memo

0.00

***RE-CHECK TORQUE ON CLAMP AFTER PROSEAL HAS CURED
FOR 72HOURS AS PER DWG.***

***VERIFY BY

9-89

BATCH # TO MATCH W/O

***VERIFY BY

9-89

PART # TO MATCH

W/O 157964

9-89

MAR 23 2017

250

Pick Kit

0.00

250

Packaging

Packaging

Memo

0.00

MAR 23 2017

DAS

6

9-89

DAS

27

9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____									

Work Order ID 157964

Monday, March 06, 2017 1:53:08 PM

157964

Page 10

Item ID: D212-664-201

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Aft Crosstube - High

Start Date: 3/8/2017 Start Qty: 1.00

1

Cust Item ID:

Required Date: 3/16/2017 Req'd Qty: 1.00

1

Customer:

Reference: SCHEDULED

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

260

QC4- 100% Inspect kits for completeness

0.00

260

QC

Quality Control

Memo

***VERIFY BY

157964

***VERIFY BY

W/O 157964

DAS
28
9-89
DAS
28
9-89
DAS
28
9-89

BATCH # TO MATCH W/O

PART # TO MATCH

DAS
28
9-89

MAR 24 2017

270

Packaging

0.00

270

Packaging

Packaging

Memo

Identify and pack for shipping as per PPP D212-664-201

Location : FG098

0.01

DAS
27
9-89DAS
28
9-89

MAR 24 2017

280

QC21- Final Inspection - Work Order Release

0.00

280

QC

Quality Control

Memo

0.02

DAS
21
9-89

MAR 27 2017

DAS
21
9-89

MAR 27 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐	OTHER : _____			

Picklist Print

Monday, March 06, 2017 1:53:11 PM

Page 1

Work Order ID: 157964

157964

Parent Item: D212-664-201

D212-664-201

Parent Item Name: Aft Crosstube - High

Start Date: 3/8/2017

Required Date: 3/16/2017

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP Rev:E04.02.16ReformatK/DS
IPP Rev:F 06-03-29 Remove Coments on Pick List JLM
IPP Rev:G 07-04-30 As per Rev C JLM
IPP Rev:H 08-05-22 up date Qty of rubber cushion DD verf:EC IPP REV:I
14.05.27 AS PER ECN14-570 DD VERF:JLM

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D212-664-201TRN		Manufactured	No			230	Each	3.0000	1				
D212-664-201TRN										**		DP2 17-03-10	
Crosstube Turning Detail													

Location	Loc Qty	Loc Code
LG014	3	
149731	1	
149732	1	
150748	1	

D3595-063-530

Manufactured No

230

Each

66.0000

4

4

D3595-063-530

**

Rubber Cushion 0.63" wide x 5.30" Long

Location	Loc Qty	Loc Code
FG	1	
82656	1	
LG051	1	
132515	1	
LG052	64	
138921	7	
153986	9	
156365	48	

MAR 20 2017

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Monday, March 06, 2017 1:53:11 PM

Page 2

Work Order ID: 157964

157964

Parent Item: D212-664-201

D212-664-201

Parent Item Name: Aft Crosstube - High

Start Date: 3/8/2017

Required Date: 3/16/2017

Start Qty: 1.00

Required Qty: 1.00

D2940-1

Manufactured No

230

Each

9.0000

2

2

D2940-1

Support

2

[Signature]

MAR 20 2017

Location

Loc Qty

Loc Code

LG051

3

151516

3

LG052

6

153824

6

MS21920-28

Purchased

No

230

Each

68.0000

4

4

MS21920-28

Clamp

4

[Signature]

MAR 20 2017

Location

Loc Qty

Loc Code

FG

1

105884

1

LG050

43

M136512

18

M136579

25

LG051

1

M132169

1

LG057

2

M134130

2

st543

21

M136740

21

D3428-1

Manufactured

No

250

Each

16.0000

1

1

D3428-1

Placard

MAR 23 2017

DAS
6
9-89

DAS
27
9-89

Location

Loc Qty

Loc Code

ST034

16

152358

4

11/8/2017

154443

12

12/23/2017

Monday, March 06, 2017 1:53:11 PM

Shop Packet Print

Page 2

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

Picklist Print

Monday, March 06, 2017 1:53:11 PM

Page 3

Work Order ID: 157964

157964

Parent Item: D212-664-201

D212-664-201

Parent Item Name: Aft Crosstube - High

Start Date: 3/8/2017

Required Date: 3/16/2017

Start Qty: 1.00

Required Qty: 1.00

MS21042L6

Purchased

No

250

Each

121.0000

6

6

MS21042L6

Nut

DAS
28
9-89

Location

Loc Qty

Loc Code

OVER007

50

m136740

50

ST303

71

m136295

21

m136450

50

**

MAR 23 2017

DAS
6
9-89

DAS
27
9-89

NAS1149D0663J

Purchased

No

250

Each

770.0000

18

18

NAS1149D0663J

Washer

DAS
28
9-89

Location

Loc Qty

Loc Code

ST260a

500

M136787

500

ST263

270

M136192

270

**

MAR 23 2017

DAS
6
9-89

DAS
27
9-89

AN6-40A

Purchased

No

250

Each

55.0000

4

4

AN6-40A

3/8-24 Bolt X 3" Long

DAS
28
9-89

Location

Loc Qty

Loc Code

over005

24

M136740

24

ST333

31

M136295

31

**

MAR 23 2017

DAS
6
9-89

DAS
27
9-89

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date: _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐		Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐					
OTHER : _____									

Picklist Print

Monday, March 06, 2017 1:53:11 PM

Work Order ID: 157964

157964

Parent Item: D212-664-201

D212-664-201

Parent Item Name: Aft Crosstube - High

Start Date: 3/8/2017

Required Date: 3/16/2017

Start Qty: 1.00

Required Qty: 1.00

AN6-41A

Purchased

No

250

Each

40.0000

2

2

AN6-41A

Bolt

MAR 23 2017

DAS
27
9-89

DA
28
9-89

Location

Loc Qty

Loc Code

over005

20

M134508

0

M136787

20

ST333

20

M136406

20

2_____

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																																	
Date : _____		Step #: _____		QTY Effective : _____			MRB (QSI042) Approval																																																														
Description Work Order Deviation				Disposition				Completed By																																																													
								Lead hand / Supervisor Approval Verification																																																													
								QC / QA Coordinator Approval																																																													
Root Cause		FAULT CATEGORY																																																																			
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐																																																																				

DART AEROSPACE LTD	Work Order: 157964
Description: Crosstube High Aft (205/212)	Part Number: D212-664-201
Inspection Dwg: D212-664-241 Rev: E	Page 1 of 1

Required Dimension	Min	Max
Height	24.17	24.43
1/2 Span	53.59	53.85
Angle	49	52
Total Span	107.18	107.70
Bending Passes	5	--
Crushing	--	7.2%

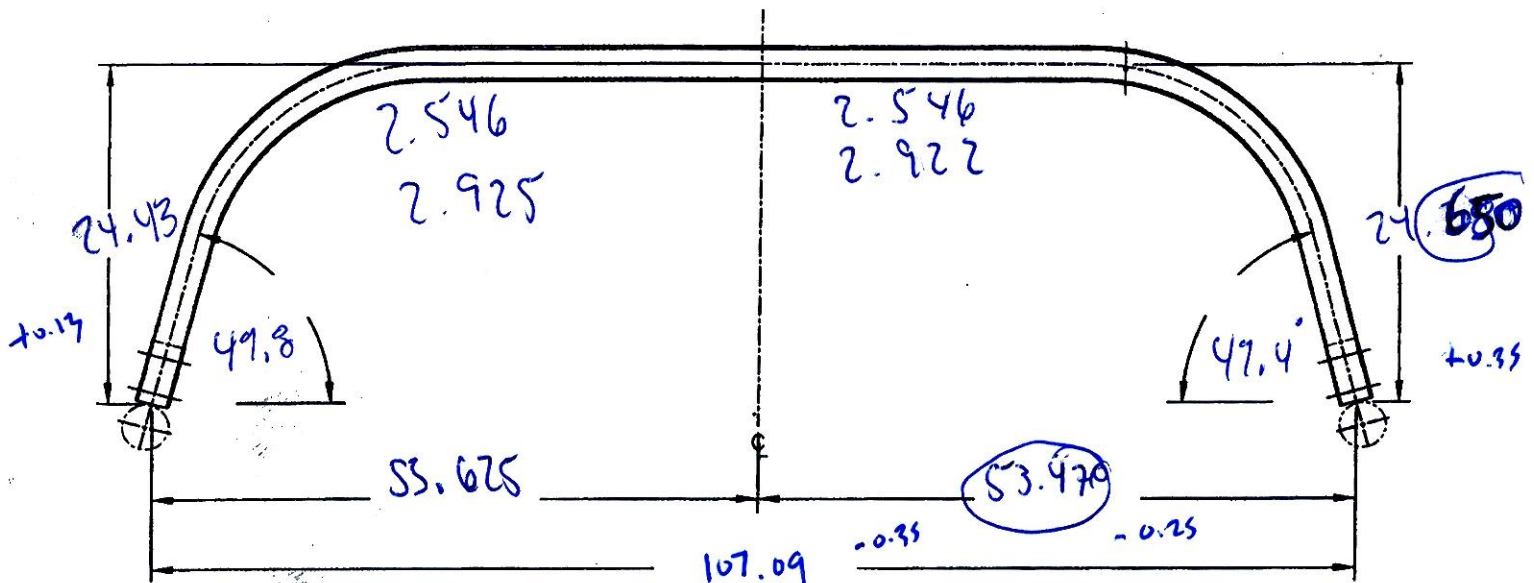

	Side A	Side B
Bending Passes	6.9%	6.9%
Crushing	6.9%	6.9%
Comments		

QC15 Inspection	9-89
Date	17-03-15

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	07.05.08	Dimensions updated per Dwg rev. C	KJ/JLM	
C	10.04.01	Dwg Rev updated	KJ	
D	12.04.16	Added bending, crushing dimensions	KJ	
E	14.07.08	Crushing percentage revised	KJ	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					

Root Cause				FAULT CATEGORY			
☐ Environment	☐ No Re-verification	☐ Pressure/Forced	☐ Temperature/Cure	☐ Power Loss/Surge	☐ Positioned Wrong		
☐ Design	☐ Operator	☐ Bending	☐ Set-up	☐ Folio/Program	☐ Outside Dimensions		
☐ Doc/Data	☐ Offset/Setup	☐ Centre Not Concentric	☐ BOM/Route	☐ Grain	☐ Over/Under tolerance		
☐ Equip/Tooling	☐ Supplier	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Part Incorrect		
☐ Handling/Pre	☐ Training	☐ Crimp/Kink/Ripple/Wave	☐ Inspection Incomplete/Unqualified	☐ Wrong Stock Pulled	☐ Part Lost/Missing		
☐ Material	☐ Use for Testing	☐ Cuffs	☐ Contamination	☐ Out of Sequence	☐ Part Moved		
☐ Internal Transport	☐ Poor Information	☐ Crushing	☐ Countersink	☐ Off-set	☐ Drawing		
☐ Tribal Knowledge	☐ Rushing	☐ Heat Treat	☐ Cut Too Short	☐ Mislabeled	☐ Finish		
☐ LOA	☐ Product Improvement	☐ Wave/Twist in Tube	☐ Instructions Incomplete/Unclear	☐ Fit/Function	☐ Misread		
☐ Substation	☐ Process Improvement	☐ Marks/Chatter	☐ Drill Holes	☐ Misaligned/off center	☐ Turning Sequence		
☐ Past Expiry Date	☐ Manufacturing Process	OTHER :					
☐ Misidentified	☐ Past Due						

Item	Qty -241	Qty -241B	Part Number	Description
1	X		D212-664-241	CROSSTUBE ASSEMBLY (205/212 HIGH AFT)
2		X	D212-664-241B	CROSSTUBE ASSEMBLY (214 HIGH AFT)
3	1	1	D6006-129	CROSSTUBE
4	2		D2940-1	SUPPORT
5	4	4	D3595-063-530	RUBBER CUSHION
6		2	D5018-1	SUPPORT
7	4	4	MS21920-28	CLAMP (OR MS21920-30)
8	A/R	A/R	PROSEAL 890 B-2	SEALANT, AMS-S-8802 CLASS B-2

GENERAL NOTES:

- MATERIAL: MANUFACTURED FROM D6006-129
FINISHED LENGTH = 124.362±0.020
- FINISH: a) CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
b) PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
c) MASK UNDERSIDE OF CROSSTUBE AS SHOWN (ZN C6-2 / C6-3, HATCHED AREA)
d) PAINT OUTSIDE PER DART QSI 005 4.2
e) REMOVE MASKING AND APPLY MATTE CLEAR COAT
- TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- UNITS: INCHES UNLESS OTHERWISE NOTED.
- BREAK SHARP EDGES: 0.005 TO 0.010 MAX.
- IDENTIFICATION: SCRIBE DART PART NUMBER "D212-664-XXX" AND BATCH NUMBER ON INSIDE OF CUFF USING VIBRATING STYLUS.
- WEIGHT: D212-664-241/-241B = 44.2 lbs
- PART IS SYMMETRIC ABOUT CENTERLINE.
- EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.

MACHINING

- RUN CUTTER OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.

BENDING

- BEND PROGRESSIVELY WITH A MINIMUM OF 5 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 7.2% (BASED ON O.D.) IN LOWER HALF OF R35.5 BEND AND 6% (BASED ON O.D.) ON REMAINING TUBE.
- LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.

ASSEMBLY

- INSTALL D2940-1 / D5018-1 SUPPORT: ABRASE MATING SURFACE OF SUPPORT AND CROSSTUBE WITH 180-GRIT SANDPAPER AND REMOVE RESIDUE WITH MEK (OR EQUIVALENT). APPLY A 0.04" TO 0.07" THICK LAYER OF PROSEAL 890 CLASS B-2 (OR AMS-S-8802 CLASS B-2) SEALANT TO MATING SURFACE OF SUPPORT.
- INSTALL MS21920-28 CLAMPS (OR -30) WITH D3595-063-530 RUBBER CUSHIONS TO SECURE THE SUPPORT ON TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE ON TOP SIDE OF CROSSTUBE.
- TORQUE CLAMPS 80 TO 100 IN-LB. ENSURE AT LEAST 1.5 THREADS SHOWING IN SAFETY AND THAT NUT HAS NOT BOTTOMED-OUT AFTER TORQUING. PRIOR TO PACKAGING, RE-CHECK TORQUE ON CLAMPS AFTER PROSEAL 890 SEALANT HAS CURED FOR 72 HOURS.

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 157964 *mjs*
170306

RELEASED
2014-05-26
WP

E	D5018-1 WAS D2940-1 (-241B), PROSEAL WAS MAGNOBOND, NOTE 2: ADD INSPECTION WINDOW, NOTE 11: ALLOW 7.2% CRUSH, NOTE 15: ADD 72HR CURE AND RETORQUE FOR PROSEAL, ADD SHEET 3, CLAMPS REVERSED TO PREVENT CHAFING (ZN B7-2, B7-3), BEND HEIGHT TOL. NOW 0.25 WAS 0.13 (C1-4), INCORP DEO D-1/2	CP	14.04.01
D	REFORMAT/REVISE GENERAL NOTES/PART LIST; REORGANIZED VIEWS AND REFORMATTED DRAWING TO CURRENT STANDARDS; ADD -241B (ZN D4-2, B4-2); REMOVED REF & ADD TOLERANCES (ZN D8-3 & C4-3, C6-3 & A8-3); RELOCATED FLAG #6 PER PAR 08-048 (ZN A5-3); MOVED TURNING DETAIL & UPDATED TOLERANCE TO SHEET 4	RF	09.09.30
C	REMOVE -100S ABRASION STRIP; ADD MAGNOBOND 8398, CUSHION, REVERSE CLAMPS	PH	07.03.08
B	ADD HOLES FOR COMPATABILITY WITH BHT/AA SKIDTUBES	PH	05.02.04
A	NEW ISSUE	CP	00.12.12
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>DP</i>		
DRAWN	<i>DP</i>		
CHECKED	<i>DW</i>		
MFG. APPR.	<i>DP</i>		
APPROVED	<i>DP</i>		
DE APPR.	<i>DP</i>		
DATE	14.04.01		
DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA DRAWING NO. D212-664-241 REV. E SHEET 1 OF 5 TITLE CROSSTUBE ASS'Y (205/212 HI AFT) SCALE NTS COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE


QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐							
Date : _____		Step #: _____		QTY Effective : _____		MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval			
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : _____							

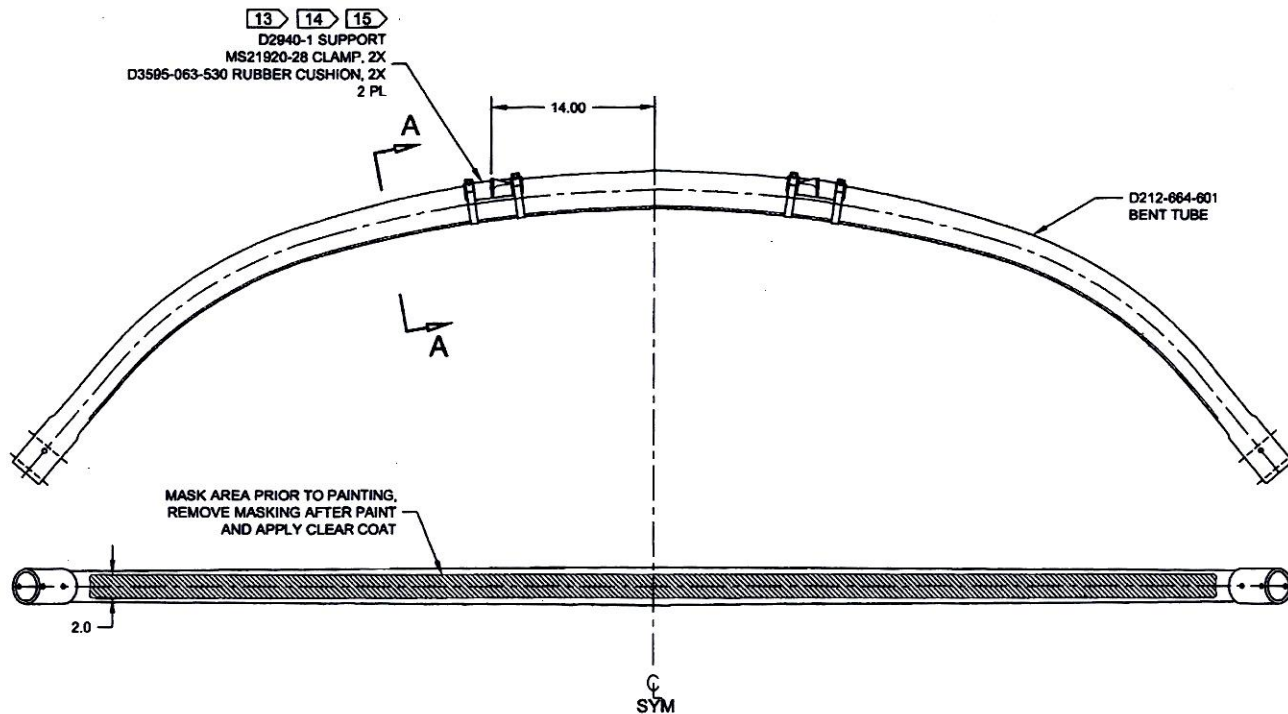

D212-664-241
ASSEMBLY DETAIL

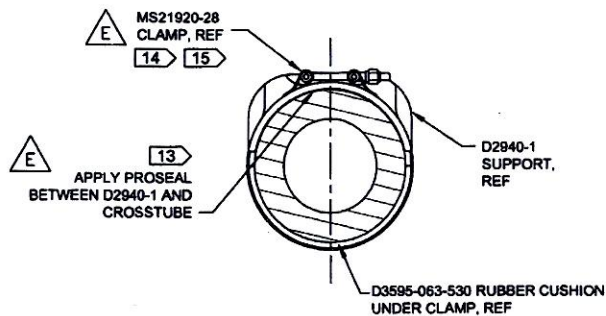

SECTION A-A
SCALE 4X

RELEASED
2014-05-26
MJP

DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED		DRAWING NO.	REV. E
MFG. APPR.		D212-664-241	SHEET 2 OF 5
APPROVED		TITLE	SCALE
DE APPR.		CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNITIES TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____




WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

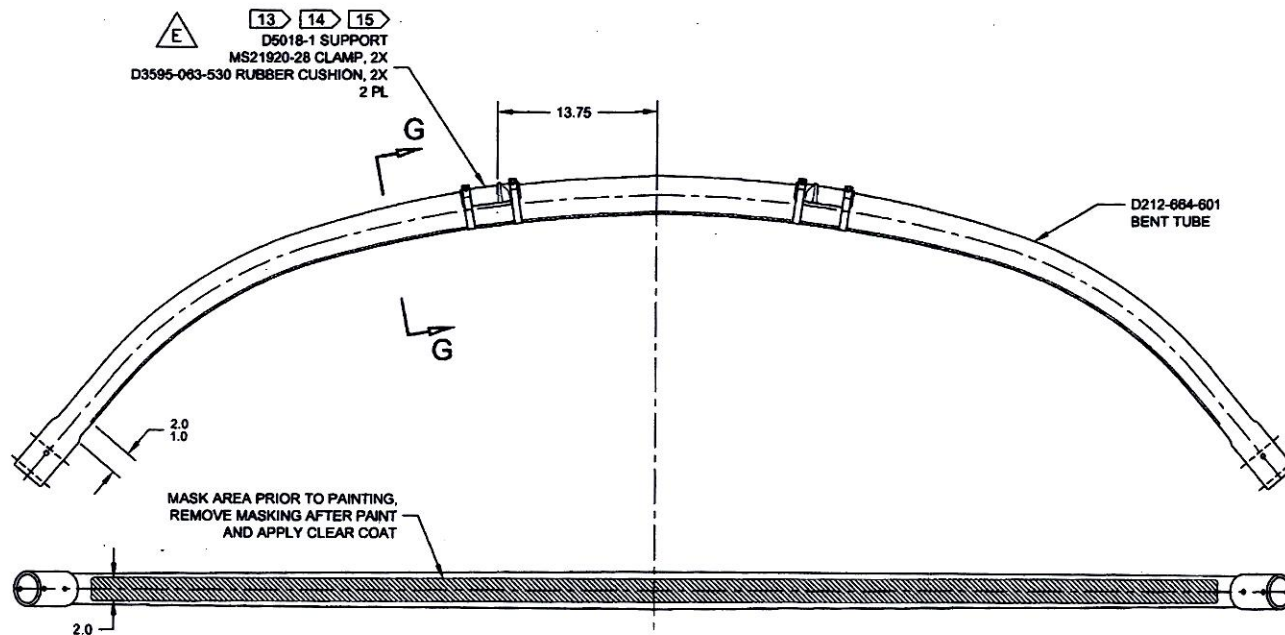

SECTION G-G
SCALE 4X

D212-664-241B
ASSEMBLY DETAIL

RELEASED
2014-05-26

DESIGN	40	DART AEROSPACE LTD	
DRAWN	40	HAWKESBURY, ONTARIO, CANADA	
CHECKED	DLW	DRAWING NO.	REV. E
MFG. APPR.	40	D212-664-241	SHEET 3 OF 5
APPROVED	40	TITLE	SCALE
DE APPR.	40	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____		MRB (QSI042) Approval	
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor Approval Verification
					QC / QA Coordinator Approval
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		FAULT CATEGORY Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Mislabelled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : _____					

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐


Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval		
Description Work Order Deviation				Disposition				Completed By	
								Lead hand / Supervisor Approval Verification	
								QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY							
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐				
Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐				
Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BDM/Route ☐	Grain ☐	Over/Under tolerance ☐				
Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐				
Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐				
Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐				
Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐				
Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐				
LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐				
Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐				
Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____							
Misidentified ☐	Past Due ☐								

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

R100.0 TRANSITION
BETWEEN TAPERED
SECTIONS

0.515 WALL
STOCK, REF

SEE DETAIL D

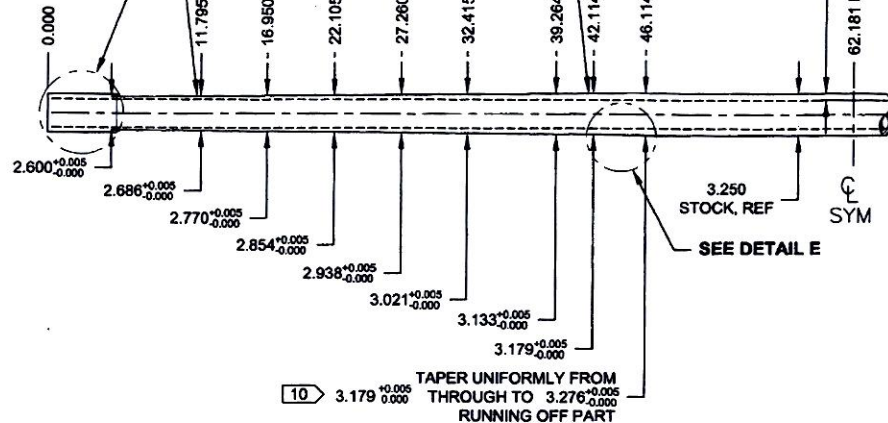


10
30° X 0.500 DEEP
CHAMFER

R0.063


SEE DETAIL F

DETAIL D:
CROSSTUBE CUFF
SCALE 5X

D212-664-241TRN
TURNING DETAIL

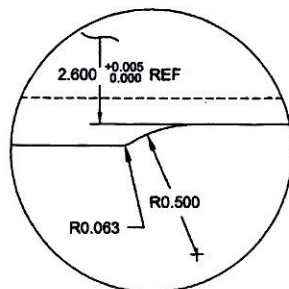

DETAIL F:
CUFF TRANSITION
SCALE 10X

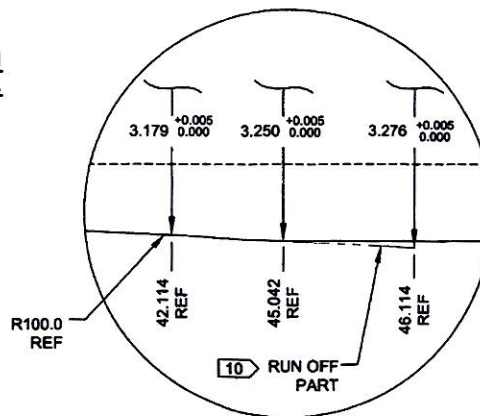

DETAIL E:
TAPER RUN-OFF
NOT TO SCALE

RELEASED
2014-05-26

DESIGN	<i>JP</i>	DART AEROSPACE LTD	
DRAWN	<i>JP</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>JS</i>	DRAWING NO.	REV. E
MFG. APPR.	<i>JS</i>	D212-664-241	SHEET 5 OF 5
APPROVED	<i>JS</i>	TITLE	SCALE
DE APPR.	<i>JS</i>	CROSSTUBE ASS'Y (205/212 HI AFT)	NTS
DATE	14.04.01	COPYRIGHT © 2000 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐																																																													
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval																																																										
Description Work Order Deviation				Disposition				Completed By																																																									
								Lead hand / Supervisor Approval Verification																																																									
								QC / QA Coordinator Approval																																																									
Root Cause		FAULT CATEGORY																																																															
Environment ☐	No Re-verification ☐	Pressure/Forced ☐	Temperature/Cure ☐	Power Loss/Surge ☐	Positioned Wrong ☐	Design ☐	Operator ☐	Bending ☐	Set-up ☐	Folio/Program ☐	Outside Dimensions ☐	Doc/Data ☐	Offset/Setup ☐	Centre Not Concentric ☐	BOM/Route ☐	Grain ☐	Over/Under tolerance ☐	Equip/Tooling ☐	Supplier ☐	Cracks ☐	Broken/Damage/Defect ☐	Weld ☐	Part Incorrect ☐	Handling/Pre ☐	Training ☐	Crimp/Kink/Ripple/Wave ☐	Inspection Incomplete/Unqualified ☐	Wrong Stock Pulled ☐	Part Lost/Missing ☐	Material ☐	Use for Testing ☐	Cuffs ☐	Contamination ☐	Out of Sequence ☐	Part Moved ☐	Internal Transport ☐	Poor Information ☐	Crushing ☐	Countersink ☐	Off-set ☐	Drawing ☐	Tribal Knowledge ☐	Rushing ☐	Heat Treat ☐	Cut Too Short ☐	Mislabeled ☐	Finish ☐	LOA ☐	Product Improvement ☐	Wave/Twist in Tube ☐	Instructions Incomplete/Unclear ☐	Fit/Function ☐	Misread ☐	Substation ☐	Process Improvement ☐	Marks/Chatter ☐	Drill Holes ☐	Misaligned/off center ☐	Turning Sequence ☐	Past Expiry Date ☐	Manufacturing Process ☐	OTHER : _____			
Misidentified ☐	Past Due ☐																																																																

DART SERVICE INSTRUCTION

TO AMEND INSTRUCTIONS FOR CONTINUOUS AIRWORTHINESS ICA-D212-664 Rev. 6 OR LATER

REF. CANADIAN STC: SH01-9
REF. FAA STC: SR01298NY
REF. EASA STC: EASA.IM.R.S.01304

PURPOSE:

The supports on the following crosstubes are now installed using Proseal instead of Magnobond:

D212-664-101/-101B @ CHG 005	D212-664-201/-201B @ CHG 005
D412-664-105 @ CHG 002	D212-664-207/-207B @ CHG 002
D212-664-107/-107B @ CHG 002	

CHANGE:

For the crosstubes listed above, section 32.4 of ICA-D212-664 is amended as follows. Use Figure 1 of this service instruction and Figures 32-2 to 32-9 of ICA-D212-664 for further reference. For crosstubes of an earlier change number, it is recommended that if the supports are removed, the supports should be reinstalled using the procedure listed below.

32.4 SUPPORT INSTALLATION

- 32.4.1 Locate the area on the crosstube for installation of support (see Figure 1 of this service instruction). For D212-664-101/-107/-201/-207 and D412-664-105 crosstubes, the outward face of the support tabs should be 14.0" (355mm) from the crosstube center for 204/205/210/412/UH-1 aircraft. For installation on 214B/B-1 aircraft, the outward face of the support tabs should be 13.75" (349mm). Ensure paint finish of crosstube is intact; touch up as required per Chapter 5 (5.3.9) of ICA-D212-664.
- 32.4.2 If present, remove any paint/primer on bottom of supports. Abrade mating surfaces of support and crosstube with 400-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.3 Ensure a layer of 3M Scotch-Weld 2216 B/A Epoxy Adhesive is on the bottom of the support. If required, either apply or touch-up support to have a 0.03" to 0.05" thick layer of adhesive over the entire mating surface. Allow supports to cure for 24 hours.
- 32.4.4 Abrade mating surfaces of support (after cure) and crosstube with 180-grit sandpaper. Saturate a clean cloth with MEK or 4105S Wash'n'Wipe Degreaser or equivalent and wipe until there is no residue.
- 32.4.5 Apply a 0.04" to 0.07" thick layer of Proseal 890 Class B or AMS-S-8802 Class B sealant underneath applicable support and install support as shown in Figure 1 of this service instruction.
- 32.4.6 Install the clamps opposite to crosstube support as shown in section A-A of Figure 1. Install rubber cushions underneath each clamp around the bottom circumference of the crosstube up to the crosstube centerline. Torque clamps 80-100 in·lb (9.0-11.3 Nm). It is acceptable to use smaller or larger sized MS21920-XX clamps than those listed in ICA-D212-664, ensure that after torquing the clamps per this instruction, the nuts are in safety but not bottomed out
- 32.4.7 Prior to installing crosstube on aircraft, allow supports to cure for 72 hours and recheck torque on clamps.

CANADA	
DEPARTMENT OF TRANSPORT	
AIRCRAFT CERTIFICATION	
BRANCH	
DAO # 01-O-01	
APPROVED	
BY:	
	D. SHEPHERD (DE # 02)
DATE:	11.07.20
CERT. NO.:	SH01-9
ISSUE NO.:	3

B	ADD 3M 2216 ADHESIVE TO SUPPORT	CP	11.07.15
A	NEW ISSUE	CP	11.06.14
REV.	DESCRIPTION	BY	DATE
DESIGN		DART AEROSPACE LTD	
DRAWN		HAWKESBURY, ONTARIO, CANADA	
CHECKED	ASS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9563	SHEET 1 OF 2
APPROVED		TITLE	SCALE
DE APPR.		SUPPORT INSTALLATION CHANGE	NTS
DATE	11.07.15	COPYRIGHT © 2011 BY DART AEROSPACE LTD	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.			

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐					
Date :		Step #:		QTY Effective :			MRB (QSI042) Approval Completed By Lead hand / Supervisor Approval Verification QC / QA Coordinator Approval		
Description Work Order Deviation				Disposition					
Root Cause Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐		Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐		FAULT CATEGORY Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐		Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
		OTHER : ☐							

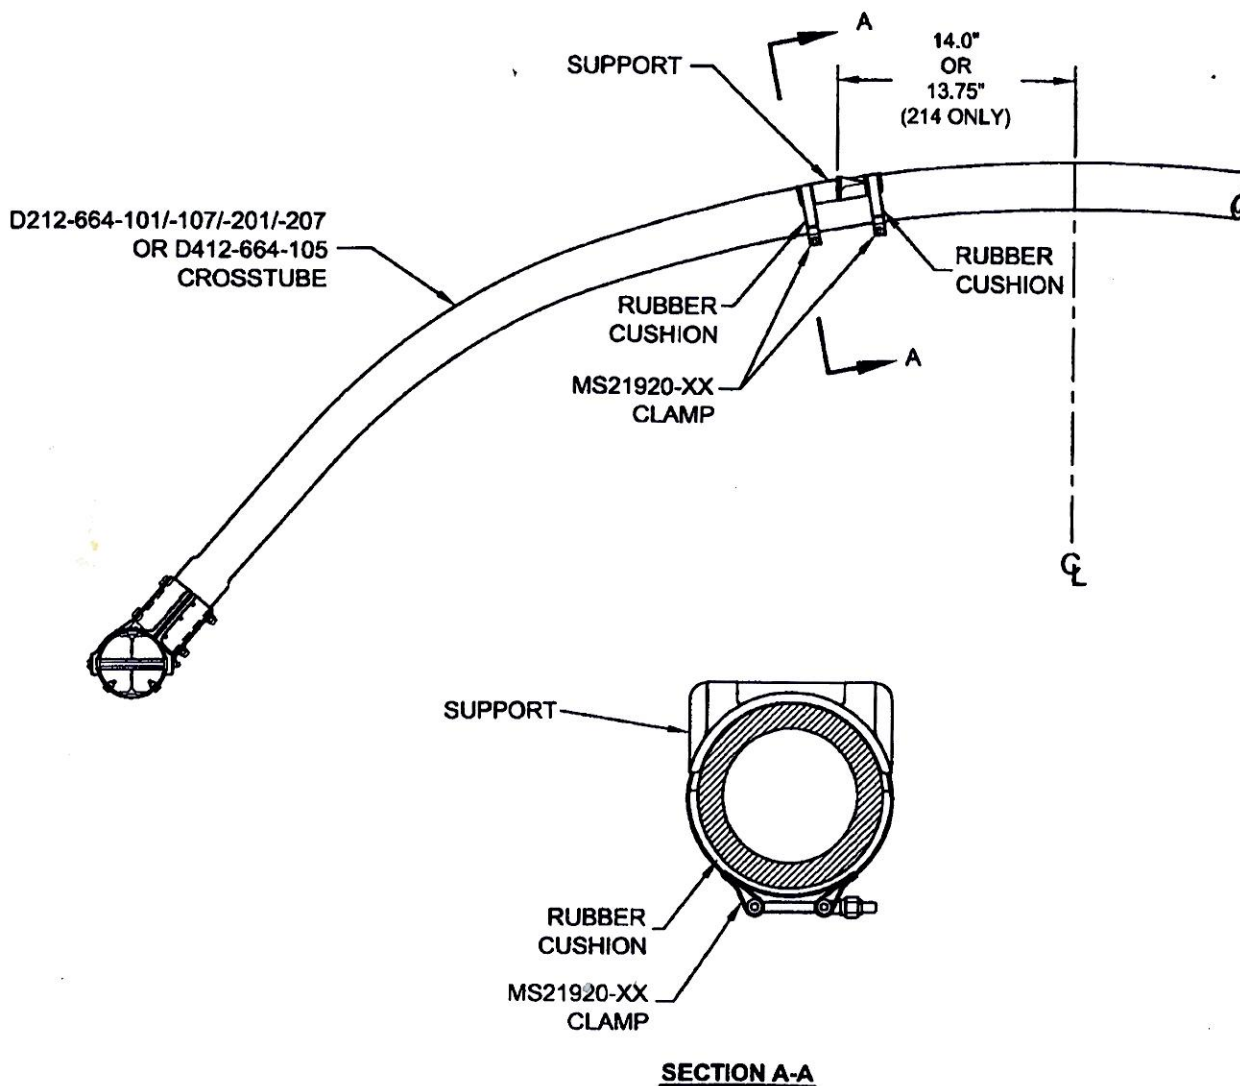


FIGURE 1: SUPPORT INSTALLATION

CANADA
DEPARTMENT OF TRANSPORT
AIRCRAFT CERTIFICATION
BRANCH
DAO # 01-O-01

APPROVED
[Signature]
BY: D. SHEPHERD (DE # 02)

DATE: 11.07.20
CERT. NO.: SH01-9
ISSUE NO.: 3

DESIGN	90	DART AEROSPACE LTD	
DRAWN	90	HAWKESBURY, ONTARIO, CANADA	
CHECKED	ASS	DRAWING NO.	REV. B
MFG. APPR.	N/A	DSI 9563	SHEET 2 OF 2
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	SUPPORT INSTALLATION CHANGE	NTS
DATE	11.07.15	COPYRIGHT © 2011 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: _____ Part No. _____ NCR No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐ Suspected Unapproved ☐	AGAINST DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Thermoforming ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐ Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐ Engineering ☐ Quality ☐ Other ☐			
Date : _____	Step #: _____	QTY Effective : _____	MRB (QSI042) Approval		
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor Approval Verification	
				QC / QA Coordinator Approval	
Root Cause		FAULT CATEGORY			
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☐ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐ No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ Crimp/Kink/Ripple/Wave ☐ Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐ Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐ Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐			
OTHER : ☐					

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
Tel: 613 632 9577
Fax: 613 632 1053

PURCHASE ORDER

Purchase Order ID **PO35625**

Purchase Order Date 3/17/2017

PO Print Date 3/17/2017

Page Number 2 of 3

der From :
SKYSERVICE
6120 MIDFIELD ROAD
MISSISSAUGA, ONTARIO L5P 1B1
CANADA

VC-SKY001

Ship To : DART AEROSPACE LTD
1270 ABERDEEN
HAWKESBURY, ON K6A 1K7
CANADA

Contact Name
Vendor Phone 905-678-5636

Ship To Contact
Ship To Phone
Ship Via: Delivered
Ship Acct:

Buyer
Customer POID
Customer Tax # 10127-2607
Terms Net 30
Currency CAD
FOB FCA - (Free Carrier)

Line Total: \$200.00

3	157963	D212-664-201 CROSSTUBE	3/17/2017	1.00	\$200.00	\$200.00
			Yes			
			3/17/2017			

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$200.00

157964	D212-664-201 CROSSTUBE	3/17/2017	1.00	\$200.00	\$200.00
			Yes		
			3/17/2017		

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Line Total: \$200.00

5	154663	D412-664-206 CROSSTUBE	3/17/2017	1.00	\$200.00	\$200.00
			Yes			
			3/17/2017			

LIQUID PENETRANT INSPECTION AS PER QSI 038 OR
LPI AS PER ASTM 1417 LEVEL 2

Note:

3/17/2017

**skyservice****Work Order Traveler**
Sky Service F.B.O. Inc.

DOT APP 53-89 / EASA 145.7142 / BDA AMO 385

WO #: MWO31429	Customer: Dart Aerospace Ltd.	Dept: NDT YUL	Reference: PO35625
Descr:	PN:	S/N:	Qty: 1
Make:	Model:	Reg:	A/C S/N:
TSN:	CSN:	TSO:	
Task: UNSCHEDULED			Sequence: 1

Work Required:

CARRY OUT NDT ON 4 CROSSTUBES AND 6 STUDS AS PER PO35625


6 STUDS , ITEM ID# D3688-3 , WORK ORDER ID# 156942

1 AFT CROSSTUBE , ITEM ID# D412-664-209 , WORK ORDER ID# 154663

3 AFT CROSSTUBES , ITEM ID# D212-664-201 , WORK ORDERS ID# 157962, 157963, 157964

Action Taken:						Date:	Initial/Stamp:
LPI C/O IAW ASTM E-1417M-13 ***NO CRACK FOUND*** PEN. ZL-56, MPO13600, CLEANER SKC-S MPO13923 , EMU. MPO15896, DEV. MPO11715 , UV LIGHT M-20142						MAR 17 2017	 
Description	Location	P/N	Qty	Batch	S/N Off	S/N On	

I certified that the maintenance described above has been performed in accordance with the applicable standard of airworthiness.

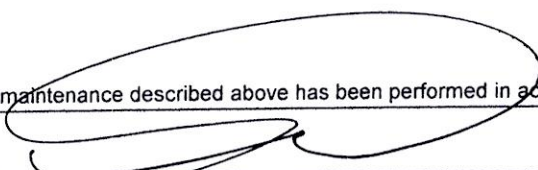Signature: 	ACA/SCA Stamp 	Date: MAR 17 2017
Name: RAFIK MELIKIAN		